INSTRUCTIONS

for Installing PRH840 medium duty CORNER HEAD to PRG540 "POP® Rivetool.

Refer to the PRG540 Instruction Manual and remove the following components fro n the tool.


PRG540-22 Nose Housing FRG540-46 Jaws

PRN Nosepiece PRG-14 Jaw Pusher


FRG540-105 Jaw Pusher Spring

PRG540-43 Mandrel Guide FRG740-11A Jaw Guide


USE PRH840-540 ADAPTOF

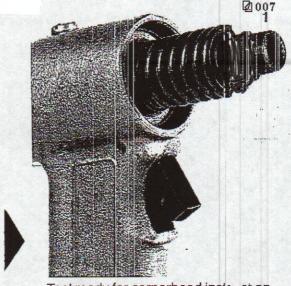


Tool ready for cornerhead insia at on

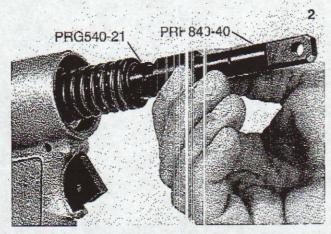


Attach (PRH840-40) draw bolt assembly to (PRG540-21) pulling head ac aptor, and tighten.

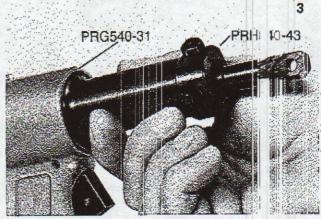

Attach (PRH840-43) corner head a: aptor to (PRG540-31) handle Assembly and tighter

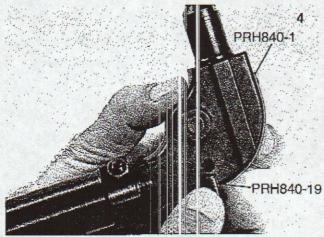

Insert end of (PRH840-40) draw bolt assembly into (PRH840) medium duty corner nead assembly with flats between (PRH840-7) bell cranks. Line up holes in (PRH840-7) bell cranks with holes in (PRH840-1) housing and (PRH840-40) draw polt assembly. Insert (PRH840-19) drawbolt pin and assemble.

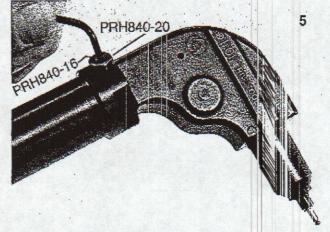

With airline connected, insert about 3/4 c mandrel length into nosepiece. Turn medium duty c: rer heac (PRH840) to desired position. Squeeze tr gcr. Hold up against adaptor and tighten PRH840-1 adaptor screw. Release trigger and tighten PRH84: 20 adaptor jam nut. Tool is now ready for operation