
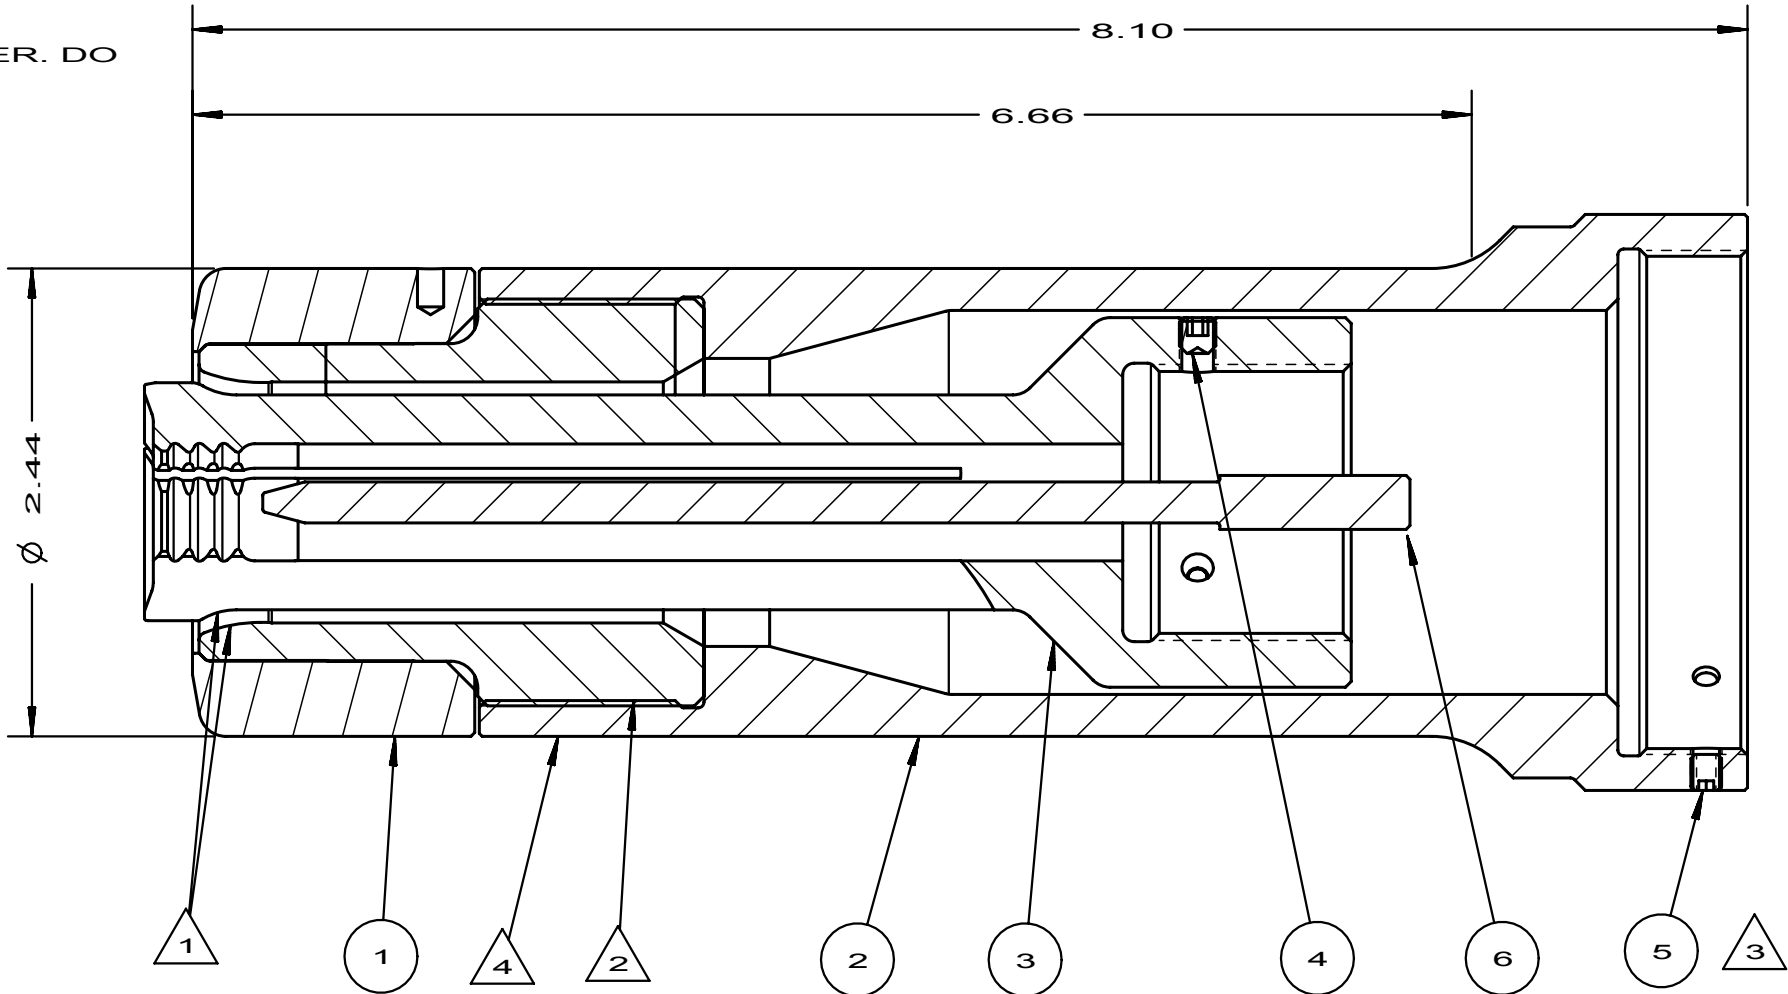


REV	DESCRIPTION	DATE
A	RELEASE	6/20/08
B	ADDED 129293, LIMIT SWITCH NOTE	8/7/09

- NOTES:
- 1 APPLY ANTI-SEIZE LUBRICANT P/N: 508183 TO OUTSIDE OF PULLER AND INSIDE OF ANVIL
 - 2 APPLY LOCTITE 242 P/N: 505016 TO THESE THREADED JOINTS PER MFR'S INSTRUCTIONS.
 - 3 APPLY VIBRA-TITE P/N: 505125 TO SET SCREW THREADS PER MFR'S INSTRUCTIONS.
 - 4 APPLY WARNING STICKER P/N: 590273 TO ANVIL HOLDER. DO NOT PERMIT STICKER TO OVERLAP ONTO ANVIL

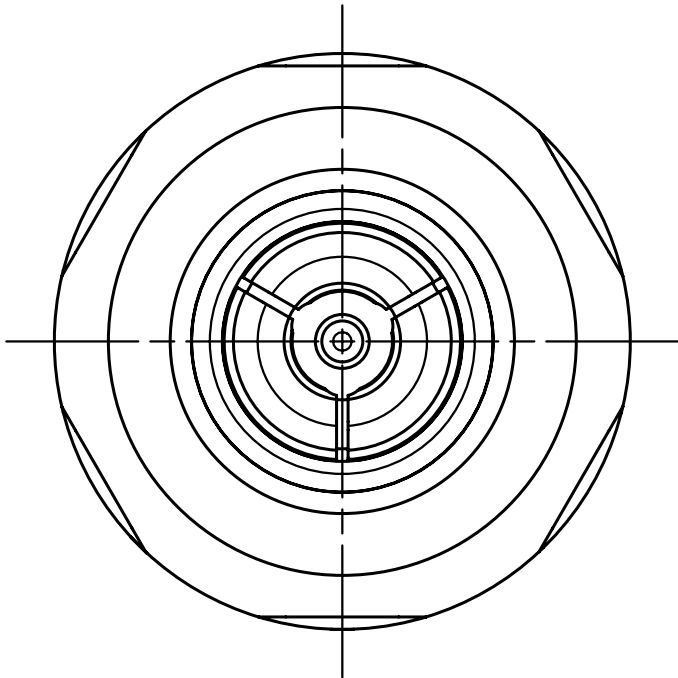

SECTION A-A

(B) LIMIT SWITCH SETTING:
WITH CONTROLLER = .616
WITHOUT CONTROLLER = .576

(B) 129293	1	ACTUATOR ROD	6
501736	1	SET SCREW	5
501920	3	SET SCREW	4
128886	1	PULLER	3
128887	1	ANVIL HOLDER	2
128890	1	ANVIL ASSEMBLY	1
PART NO.	QTY	DESCRIPTION	ITEM

HUCK INTERNATIONAL, INC., I.S.D.
1 CORPORATE DR, P.O. BOX 2270
KINGSTON, NEW YORK 12401

NOSE ASSEMBLY -28 (7/8) BOBTAIL
BTT57 TOOL

DET: TRK CK: DATE: 6/20/08 SCALE: 1:1

FOC.
FAC.

B

99-7853