
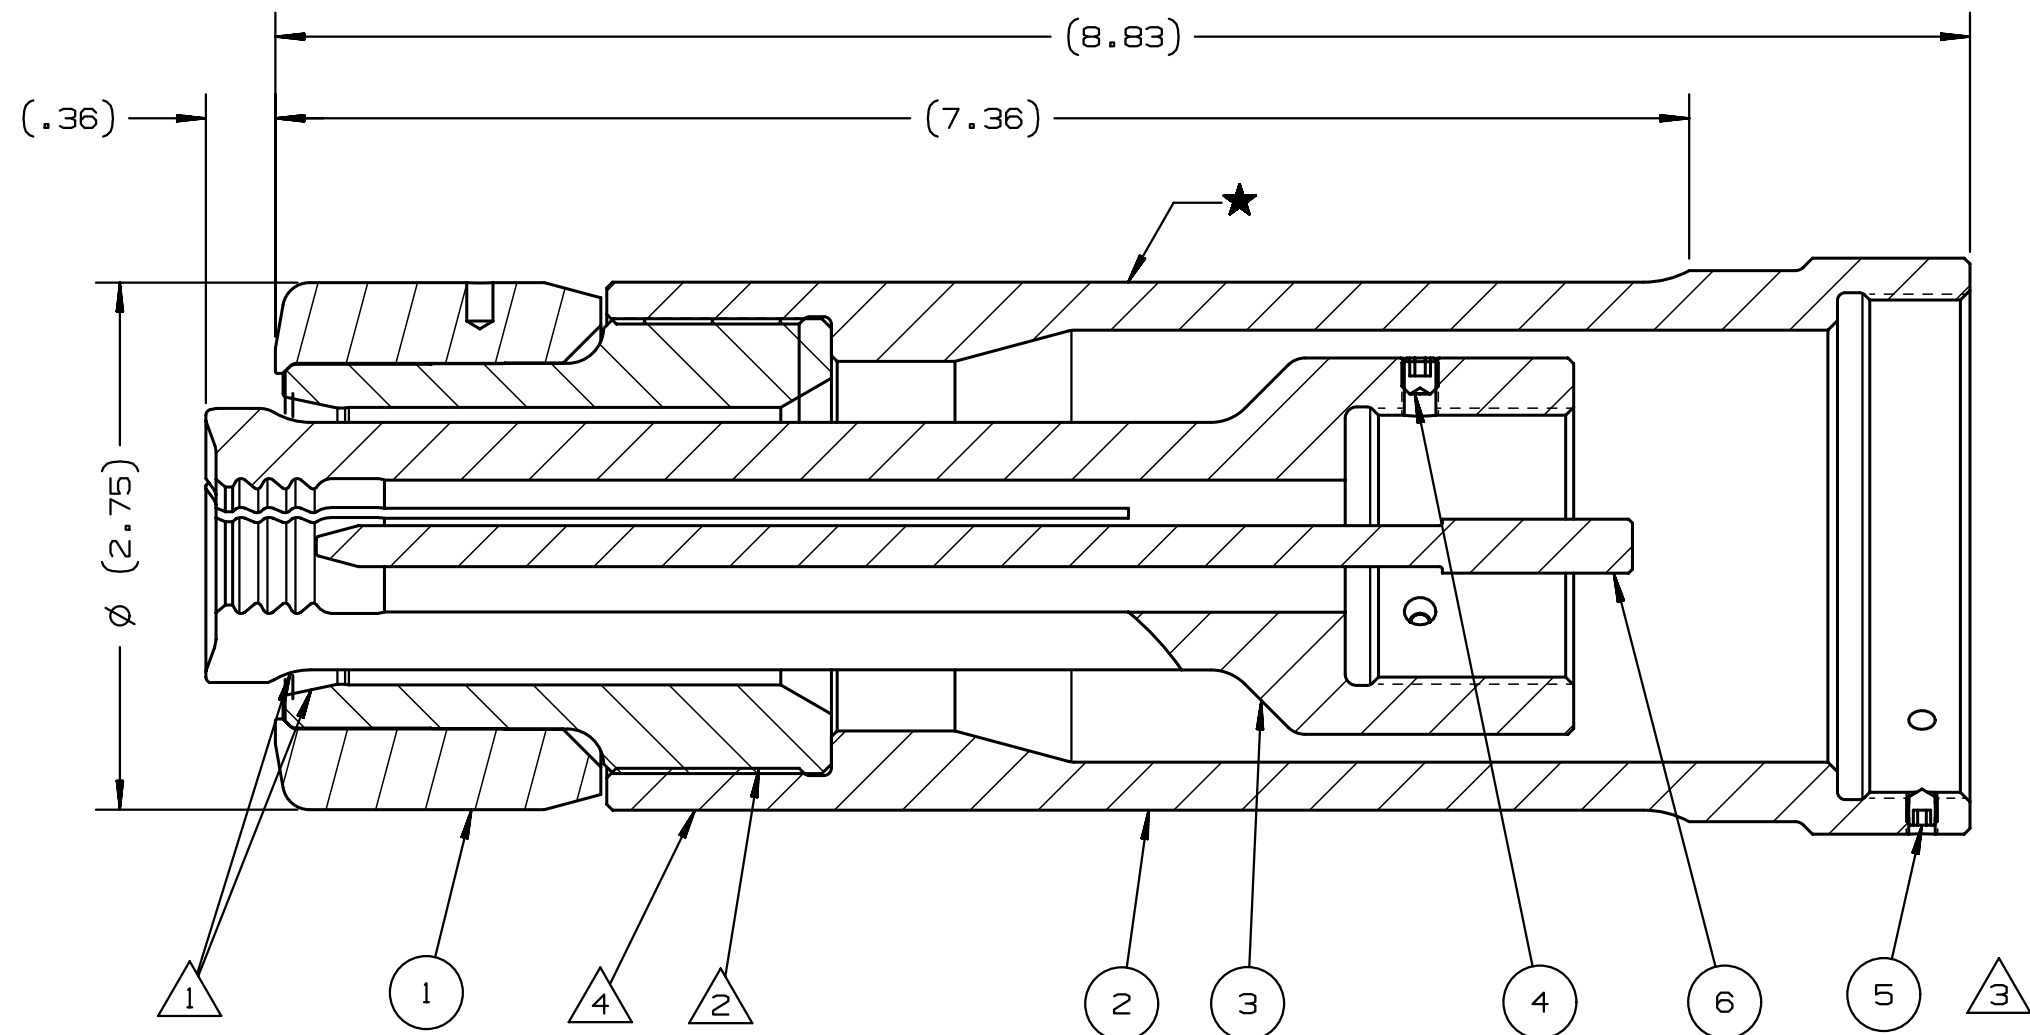


NOTES:

- 1 APPLY ANTI-SEIZE LUBRICANT P/N: 508183 TO OUTSIDE OF PULLER AND INSIDE OF ANVIL
- 2 APPLY LOCTITE 243 P/N: 508183 TO THESE THREADED JOINTS PER MFR'S INSTRUCTIONS.
- 3 APPLY VIBRA-TITE P/N: 505125 TO SET SCREW THREADS PER MFR'S INSTRUCTIONS.
- 4 APPLY WARNING STICKER P/N: 590273 TO ANVIL HOLDER. DO NOT PERMIT STICKER TO OVERLAP ONTO ANVIL

REV	DESCRIPTION	DET	DATE
A	RELEASE	SMA	12/15/17

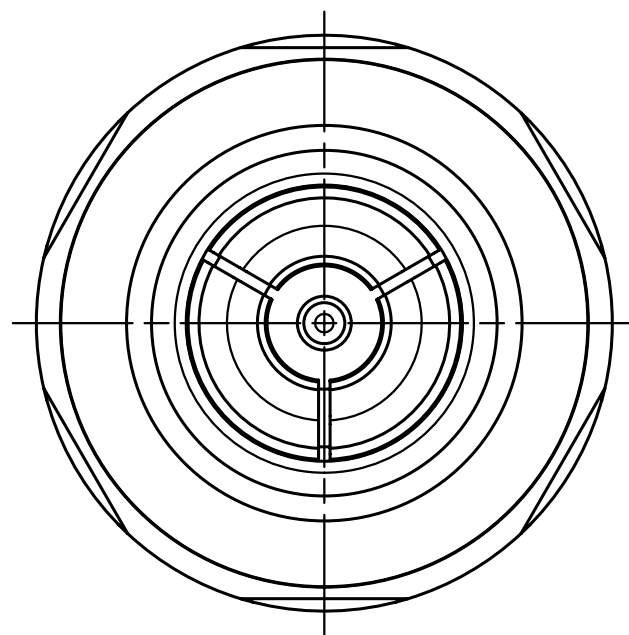

SECTION A - A

129432	1	ROD, ACTUATOR, BTT57	6
501736	1	SSCR SOC CON #08-32 X .19	5
500648	3	SSCR SOC CUP #10-32 X .19	4
129410	1	PULLER, -32 BT, BTT57	3
129414	1	HOLDER, ANVIL, BTT57, -32 BT	2
129411XA	1	ANVIL ASM, -32 BT CA	1
PART NO.	QTY	DESCRIPTION	ITEM

IDENTIFICATION PER SPEC 42-311: ★ PERMANENT	HUCK INTERNATIONAL, INC., I.S.D 1 CORPORATE DR KINGSTON, NEW YORK 12401		
ITAR/ECCN: EAR99	NOSE, -32 BT LS BTT57 TOOL		
SCH B#: 8467.99.0190	FINAL ASSY: -		
HTS: 8467.99.0190	ENG: SMA	CK:	DATE: 12/15/17 SCALE: 1:1
B		99BT-32-IRAQ-XA	